



SYNCHRO HEADING INPUT TO A-429 CONVERTER

PRODUCT P/N: 933753-00

INSTALLATION MANUAL

REV C

**Shadin Avionics
6831 Oxford Street
St. Louis Park, MN 55426
USA**

**Sales: (800)-328-0584
Technical Support: (800)-388-2849
WWW.SHADIN.COM**

MANUAL P/N: IM3753-00

**INSTALLATION MANUAL
SYNCHRO HEADING INPUT TO A-429 CONVERTER**

Rev: C

P/N 933753-00

Page i of ii

PAGE CONTROL CHART

<u>SECTION NO.</u>	<u>DESCRIPTION</u>	<u>PAGE</u>	<u>REV</u>
1.	OVERVIEW	1-1	C
	1.1 The Manual	1-1	
	1.2 Product Description	1-1	
	1.3 Specifications	1-2	
	1.4 Inputs	1-3	
	1.5 Outputs	1-3	
2.	INSTALLATION PROCEDURE	2-1	C
	2.1 Mounting	2-1	
	2.2 Electrical Connections	2-1	
3.	INSTALLATION DRAWINGS AND INSTALL KIT PARTS LIST		
<u>Drawing No.</u>	<u>Description</u>	<u>DATE</u>	<u>REV</u>
4037-270	Installation, Synchro Heading Input to A-429 Converter	3-8-06	C
IK9339	Install Kit, 26 Pin D-Sub	3-3-06	A

**INSTALLATION MANUAL
SYNCHRO HEADING INPUT TO A-429 CONVERTER**

Rev: C

P/N 933753-00

Page ii of ii

REVISION LOG

REV.	DATE	APP'D	CHANGE
–	07-23-02	ZK	Baseline Release
A	04-06-04	ZK	Updated ARINC Label format definition and electrical connections. Added MTBF
B	12-8-04	ZK	Changed company name, updated description to Arinc low speed, specifications, and Discrete Input Synchro Valid definition
C	3-8-06	CB	Updated company logo and IK9339

The information in this manual is subject to change without notification. To ensure complete and current updates, note the Revision Log above and call Technical Assistance for updated information.

INSTALLATION MANUAL**SYNCHRO HEADING INPUT TO A-429 CONVERTER**

Rev: C

P/N 933753-00

Page 1-1

1. OVERVIEW**1.1 THE MANUAL**

This manual is intended to facilitate the proper installation of the SYNCHRO HEADING INPUT to A-429 Converter. Installation instructions should be read and followed.

1.2 PRODUCT DESCRIPTION

The converter accepts the Magnetic Heading (ARINC 407 3-wire Synchro Data Inputs) and converts to A-429 low speed output label 320.

The block diagram below depicts the intended use of the converter in the aircraft installation.

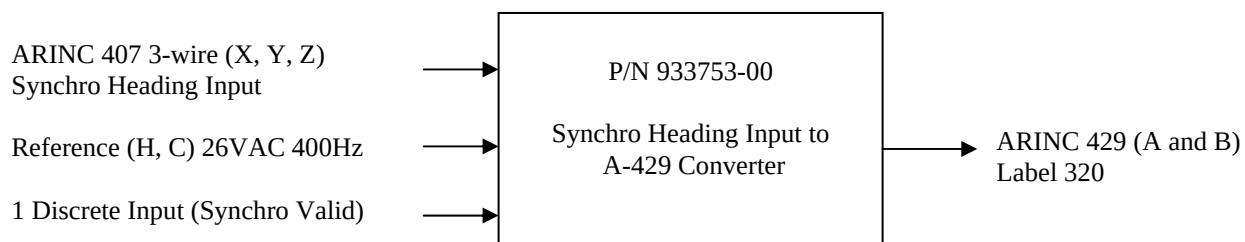


Figure 1. Block Diagram

INSTALLATION MANUAL

SYNCHRO HEADING INPUT TO A-429 CONVERTER

Rev: C

P/N 933753-00

Page 1-2

1.3 SPECIFICATIONS**Physical**

Dimensions: 1.15H x 4.30L x 2.40W

Weight: 0.4 lbs.

Electrical

Input Voltage: +28VDC

Input Current: 150mA

Input DataMagnetic Heading, ARINC 407 3-wire Synchro (Reference 26VAC 400Hz Excitation 11.8V_{L-L})

1 Discrete Input: Synchro Valid

Output Data

ARINC 429 LS Data Magnetic Heading, Label 320

Environmental

Categories: Testing Pending

Operating Temperature: -55°C to +70°C

Storage Temperature: -55°C to +85°C

Altitude: Up to 55,000 ft.

In-Flight loss of Cooling: Equipment can run indefinitely with no cooling.

MIL-HDBK-217 MTBF 69,780 hours

Certification: Pending

INSTALLATION MANUAL

SYNCHRO HEADING INPUT TO A-429 CONVERTER

Rev: C

P/N 933753-00

Page 1-3

1.4 INPUTS

This section specifies the interfaces for the Shadin SYNCHRO HEADING INPUT to A-429 Converter.

Magnetic Heading, ARINC 407 3-wire Synchro (Reference 26VAC 400Hz Excitation 11.8V_{L-L})

RX RS-232 Serial Data Input (Future use)

RX RS-422 Serial Data Input (Future use)

- 1 Discrete Input: Synchro Valid

SYNCHRO VALID	
+28VDC	VALID > 16VDC
OPEN or GND	INVALID

1.5 OUTPUTS

ARINC 429 Output Magnetic Heading Label 320:

LABEL	DESCRIPTION	FORMAT (BIT NO)	FUNCTION	BIT STATUS	
				ONE	ZERO
320	Magnetic Heading BNR Transmit Interval 50msec	01-08	LABEL		
		09	SDI		0
		10	SDI		0
		11-13	SPARES		PAD ZEROS
		14-28	BINARY ANGLE (*180/32768)		
		29	SIGN	180-360	0-180 DEG
		30-31	SM (11=Valid, 10=Invalid)		
		32	PARITY (ODD)		

TX RS-232 Serial Data Output (Future use)

TX RS-422 Serial Data Output (Future use)

INSTALLATION MANUAL

SYNCHRO HEADING INPUT TO A-429 CONVERTER

Rev: C

P/N 933753-00

Page 2-1

2. INSTALLATION PROCEDURE

2.1 MOUNTING

The SYNCHRO HEADING INPUT to A-429 Converter (P/N 933753-00) should be mounted in a dry location and the equipment may be installed in a non-pressurized and non-controlled temperature locations.

Use installation drawing, Drawing No: 4037-270, to connect the SYNCHRO HEADING INPUT to A-429 Converter to the system. Use # 6-32 screws for mounting.

2.2 ELECTRICAL CONNECTIONS

Connection to Power Supply +28 VDC

933753-00		Description
J1:9	To	+14 to +28 VDC IN
J1:26	To	Power GND

Inputs

933753-00		Description
J1:1	To	H, Reference 26VAC 400Hz
J1:5	To	RX RS-232/RS-422 (-) (Future use)
J1:6	To	RX RS-422(+) (Future use)
J1:7	To	Synchro Valid
J1:10	To	X, Synchro Input
J1:11	To	Y, Synchro Input
J1:14	To	GROUND (Signal)
J1:16	To	RX RS-232 (Download). Program Loading. No field use.
J1:19	To	C, Reference 26VAC 400Hz
J1:20	To	Z, Synchro Input
J1:24	To	GROUND (Signal)

Outputs

933753-00		Description
J1:4	To	TX RS-232 (Future use)
J1:12	To	TX ARINC 429 (A)
J1:15	To	TX RS-232 (Download). Program Loading. No field use.
J1:21	To	TX ARINC 429 (B)
J1:22	To	TX RS-422 (+) (Future use)
J1:23	To	TX RS-422 (-) (Future use)


INSTALLATION MANUAL
SYNCHRO HEADING INPUT TO A-429 CONVERTER
P/N 933753-00

SECTION 3.0

INSTALLATION DRAWINGS AND
INSTALL KIT PARTS LISTS



The following drawings are arranged in the sequence specified on page i of the Page Control Chart.

MATING CONNECTOR:
PHY 3100-26F
HOOD = CINCH # DA-24658

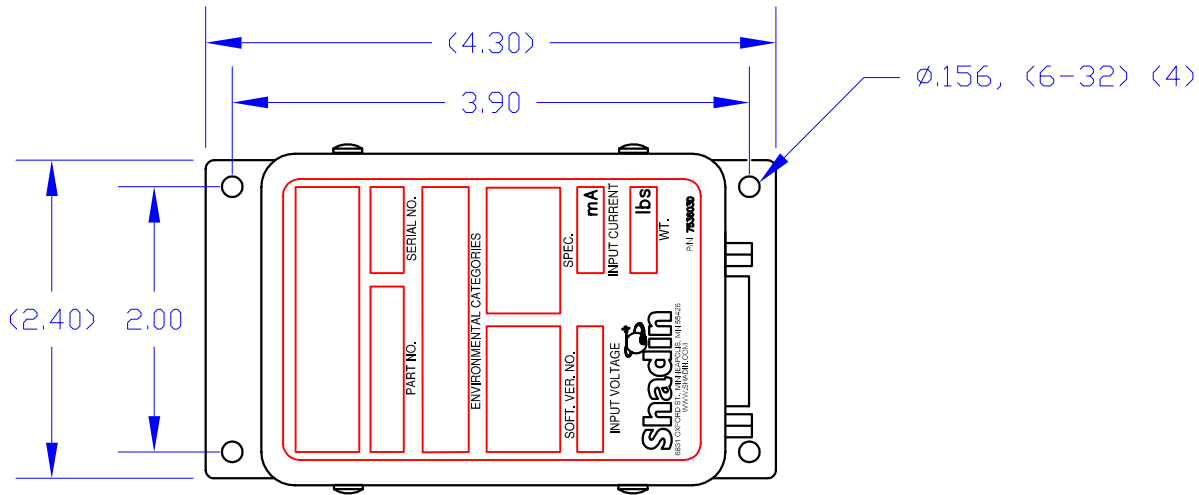

CONNECTOR WIRING

1. H, 26VAC 400 Hz REF
2. NC
3. NC
4. TX, RS-232 (FUTURE USE)
5. RX, RS-232/RS-422 (-) (FUTURE USE)
6. RX, RS-422 (+) (FUTURE USE)
7. SYNCHRO VALID
8. NC
9. +14 TO +28 VDC IN
10. X, SYNCHRO INPUT
11. Y, SYNCHRO INPUT
12. TX, ARINC 429 (A)
13. NC
14. GROUND (SIGNAL)
15. TX, RS-232 (DOWNLOAD) } PROGRAMMING ONLY,
16. RX, RS-232 (DOWNLOAD) } NO FIELD USE
17. NC
18. NC
19. C, 26VAC 400 Hz REF
20. Z, SYNCHRO INPUT
21. TX, ARINC 429 (B)
22. TX, RS-422(+) (FUTURE USE)
23. TX, RS-422(-) (FUTURE USE)
24. GROUND (SIGNAL)
25. NC
26. POWER GROUND

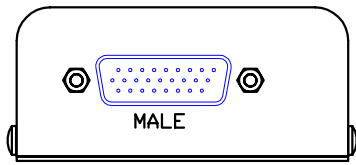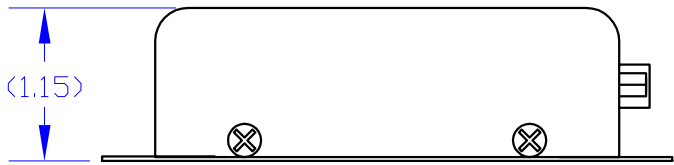

ECO #	REV.	DATE	BY	APP'D	DESCRIPTION
0602/030	C	3/8/06	PAB	CB	UPDATED LABEL & TITLE BLOCK
0412/011	B	12/8/04	PAB	ZK	UPDATED LABEL
0403/058	A	4/6/04	PAB	ZK	UPDATED CONNECTOR WIRING
0207/020	-	7/23/02	PAB	ZK	BASELINE RELEASE

UNLESS OTHERWISE NOTED DIMENSIONS ARE IN INCHES TOLERANCES: X.X = ±0.1 X.XX = ±0.01 X.XXX = ±0.005		DRAWING DATE 7/23/02		 MINNEAPOLIS, MN 55426	INSTALLATION, SYNCHRO HEADING INPUT TO A-429 CONVERTER		
		DRAFTER PAB					
		APPROVED ZK					
FINISH: N/A		FILE NAME 933753-00C.JDWG		DRAWING NO. 4037-270	SIZE A	P/N 933753-00	REV C
MATERIAL: N/A		DIRECTORY 933753-00					
DO NOT SCALE		SHEET 1 OF 1					

Report: 4037
ECO Date: February 22, 2006
Rev: A
Sec.: IX
Page 1 of 1

ECO # 0602/030
Release date: 3-3-06
Approved: CB

PARTS LIST

Part #: **IK9339**

Drawing #s: N/A

Description: **INSTALL KIT, 26 PIN D-SUB**

<u>FN</u>	<u>P/N</u>	<u>QTY.</u>	<u>DESCRIPTION</u>	<u>MFG.</u>	<u>MFG.#</u>	<u>DESIGNATION</u>	<u>COMMENTS</u>
5	230038	1	CONN, Hood 15 Pin D Sub	CIN	DA-24658		
10	230126	1	CONN, 26 Pin Hi-Density D Sub Socket	PHY	3100-26F		
15	511002	2	SCREW, 4-40 x 1/4"L, Phil Pan HD SS	MCM	91772A106		
20	541001	2	WASHER, #4 Split Lock SS	MCM	92147A005		
22	753217	1	COMPUTER LABEL, 3.5"x 15/16"	AVR	4013		
25	PK1001	1	BAG, 2.5 x 3, 4 MIL Zip Lock				
30	PK1007	1	BAG, 6 x 8, 4 MIL				

9 items